

Milling Guide for Residual Stress Measurements

DESCRIPTION

A predominant factor contributing to the structural failure of machine parts, pressure vessels, framed structures, etc., may be the residual “locked-in” stresses that exist in the object prior to its being put into service. These residual stresses are usually introduced during manufacturing, and are caused by processes such as casting, welding, machining, heat treating, molding, etc.

Residual stress cannot be detected or evaluated by conventional surface measurement techniques, since the strain sensor (strain gage, photoelastic coating, etc.) can only respond to strain changes that occur after the sensor is installed.

The most widely used practical technique for measuring residual stresses is the hole-drilling strain gage method described in ASTM Standard E837. With this method, a specially configured electrical resistance strain gage rosette is bonded to the surface of the test object, and a small shallow hole is drilled through the center of the rosette. The local changes in strain due to introduction of the hole are measured, and the relaxed residual stresses are computed from these measurements. Micro-Measurements Tech Note TN-503, Measurement of Residual Stresses By The Hole-Drilling Strain Gage Method, presents a detailed discussion of the theory and application of this technique.

The hole-drilling method is generally considered semi-destructive, since the drilled hole may not noticeably impair the structural integrity of the part being tested. Depending on the type of rosette gage used, the drilled hole is typically 0.062 or 0.125 in (about 1.5 or 3.0 mm), both in diameter and depth. In many instances, the hole can also be plugged, if necessary, to return the part to service after the residual stresses have been determined.

The practicality and accuracy of this method is directly related to the precision with which the hole is drilled through the center of the strain gage rosette. The Micro-Measurements RS-200 milling guide provides a practical means to accomplish this task.


RS-200 MILLING GUIDE

The RS-200 Milling Guide is a precision fixture for accurate positioning and drilling of a hole through the center of a special strain gage rosette. Principal features and components of the milling guide assembly are shown in the photos herein. When installed on the workpiece, the guide is supported by three levelling screws footed with swivel mounting pads to facilitate attachment to uneven surfaces.

Alignment of the milling guide relative to the strain gage rosette is accomplished by inserting a special-purpose microscope into the guide’s centering journal, and then positioning the guide precisely over the center of the rosette by means of four X-Y adjusting screws.



The microscope assembly, consisting of a polished steel housing with eyepiece, reticle, and objective lens, permits alignment to within 0.0015 in (0.038 mm) of the gage center. The microscope is also used to measure the diameter of the hole after it is drilled. An illuminator attaches to the base of the guide to aid in the optical alignment procedure.

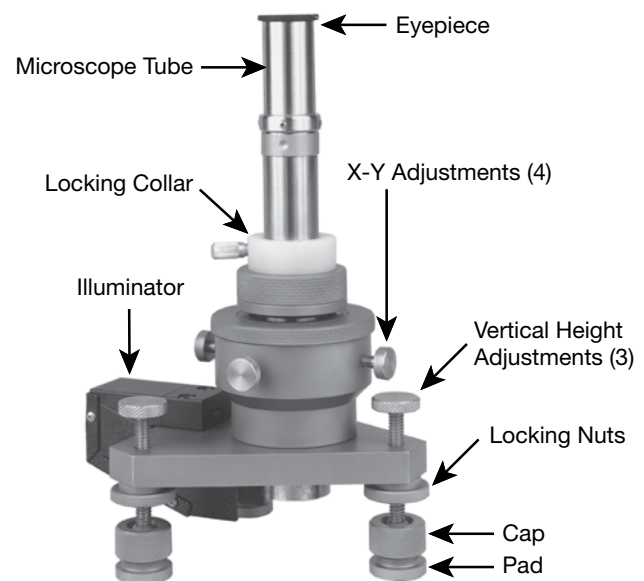

Alignment Setup

Milling Guide for Residual Stress Measurements

MILLING GUIDE FOR RESIDUAL STRESS MEASUREMENTS

After alignment, the microscope is removed from the guide, and the milling bar or high-speed air turbine is inserted in its place. The milling bar is used for slow-speed drilling of the hole. Two standard milling cutters are supplied: 0.062 in (1.6 mm) and 0.125 in (3.2 mm) diameter. The milling bar is equipped with a universal joint for flexible connection to a drill motor.


Conventional slow-speed milling may be satisfactory on some mild steels and aluminum alloys. But high-speed drilling is generally the most convenient and practical method for introducing the hole in all test materials. (When residual stresses are to be measured on materials such as stainless steels, nickel-based alloys, etc., ultra high-speed drilling techniques are preferred.) For this purpose, a high-speed air-turbine assembly, along with a supply of tungsten carbide-tipped cutters [ten each 0.031

in (0.8 mm) diameter and 0.062 in (1.6 mm) diameter], is supplied with the milling guide. A foot pedal control is included for operating the air turbine.


A micrometer depth set attachment, available in English or metric units, is provided with each milling guide assembly. This device is used for incremental drilling when information on the variation of residual-stress-with-depth is desired.

Other items supplied include a plastic template for the proper location of the milling guide foot pads on the test part and a special break-off tool used to remove the foot pads from the part after the test is completed. All components are housed in a sturdy carrying case. The guide is approximately 9 in (230 mm) high, and 4.5 in (114 mm) wide at the base.

A fast-setting-cement kit, used to firmly attach the guide to the test part, is available as an accessory item.

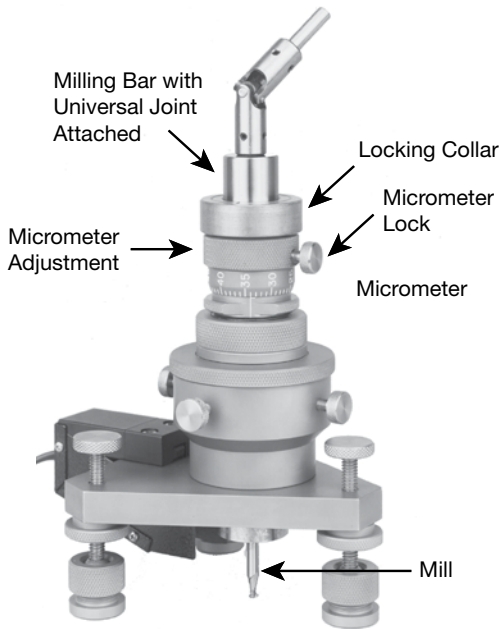

End-Mill Drilling Setup

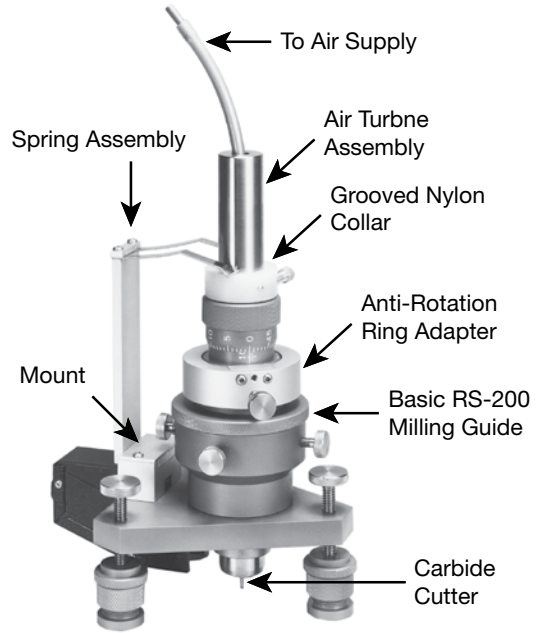

High-Speed Drilling Setup

PART NUMBER	DESCRIPTION
MMP920-000265	RS-200 MILLING GUIDE- COMPLETE UNIT (GRIP ADHESIVE ORDERED SEPARATELY)
MMF336166	RS-200-CK2 GRIP ADHESIVE (5 PACK)
REPLACEMENT PARTS	
MMP920-000193	RS-200-FP REPLACEMENT FOOT PADS QTY 3 WITH TEMPLATE
MMP100-010569	RS-200 END MILL .062 QTY 1
MMP100-010573	RS-200 END MILL .125 QTY 1
MMP20X100033	RS-200-B1 REPLACEMENT BULB FOR LIGHTSOURCE
MMP27X300006	ATC-200-062 CARBIDE-TIPPED CUTTERS (10/PKG)
MMP27X300007	ATC-200-031 CARBIDE-TIPPED CUTTERS (10/PKG)



Disclaimer

ALL PRODUCTS, PRODUCT SPECIFICATIONS AND DATA ARE SUBJECT TO CHANGE WITHOUT NOTICE.

Vishay Precision Group, Inc., its affiliates, agents, and employees, and all persons acting on its or their behalf (collectively, "VPG"), disclaim any and all liability for any errors, inaccuracies or incompleteness contained herein or in any other disclosure relating to any product.

The product specifications do not expand or otherwise modify VPG's terms and conditions of purchase, including but not limited to, the warranty expressed therein.

VPG makes no warranty, representation or guarantee other than as set forth in the terms and conditions of purchase. **To the maximum extent permitted by applicable law, VPG disclaims (i) any and all liability arising out of the application or use of any product, (ii) any and all liability, including without limitation special, consequential or incidental damages, and (iii) any and all implied warranties, including warranties of fitness for particular purpose, non-infringement and merchantability.**

Information provided in datasheets and/or specifications may vary from actual results in different applications and performance may vary over time. Statements regarding the suitability of products for certain types of applications are based on VPG's knowledge of typical requirements that are often placed on VPG products. It is the customer's responsibility to validate that a particular product with the properties described in the product specification is suitable for use in a particular application. You should ensure you have the current version of the relevant information by contacting VPG prior to performing installation or use of the product, such as on our website at vpgsensors.com.

No license, express, implied, or otherwise, to any intellectual property rights is granted by this document, or by any conduct of VPG.

The products shown herein are not designed for use in life-saving or life-sustaining applications unless otherwise expressly indicated. Customers using or selling VPG products not expressly indicated for use in such applications do so entirely at their own risk and agree to fully indemnify VPG for any damages arising or resulting from such use or sale. Please contact authorized VPG personnel to obtain written terms and conditions regarding products designed for such applications.

Product names and markings noted herein may be trademarks of their respective owners.

Copyright Vishay Precision Group, Inc., 2014. All rights reserved.